
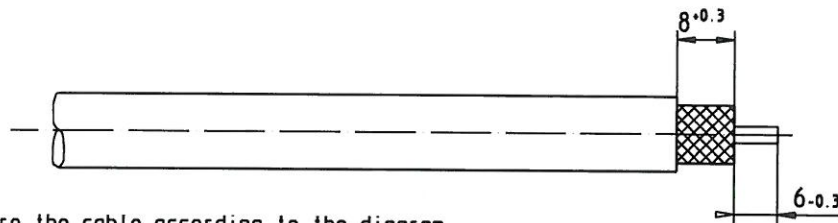


Assembly instruction: 53 B


Series: N

Straight connector
for flexible cable


Cable entry:
Center contact - soldered
Braid - clamped

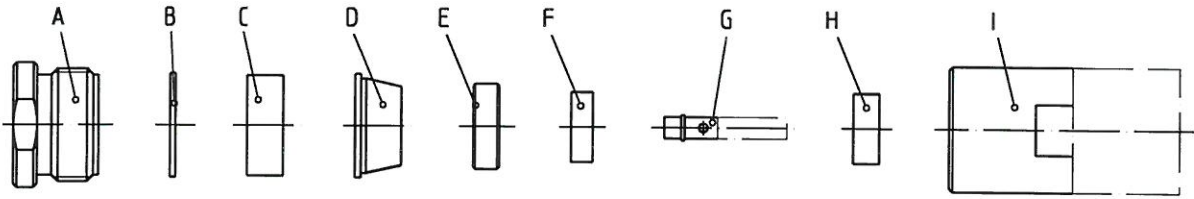


1) Prepare the cable according to the diagram.

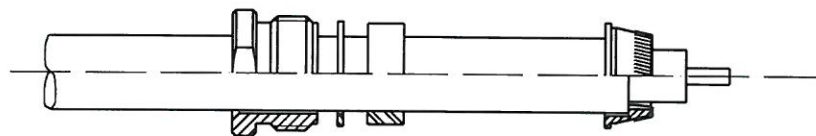

- 2) Slide nut 'A', washer 'B' and gasket 'C' onto the cable.
- 3) Push clamp 'D' over the braid and fold the braid back over the clamp.

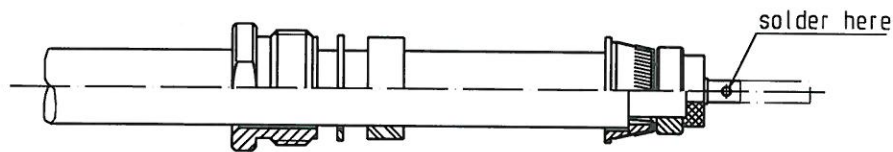

- 4) Slide clamping sleeve 'E' and insulator 'F' onto the cable dielectric.
- 5) Push center pin 'G' over the inner conductor of the cable up to the dielectric and solder it.

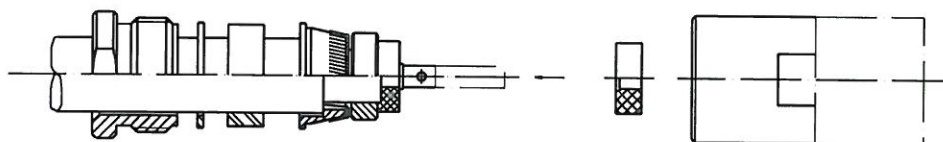

- 6) Slide insulator 'H' onto the center pin.
- 7) Insert the prepared cable into the connector body 'I' and tighten down nut 'A'.

fuer diese technische Unterlage behalten
 wir uns alle Rechte vor (DIN 34)

gesamt

Rosenberger
Hochfrequenztechnik
84526 Tittmoning

Tools:

Stripping tool
Soldering equipment
Two 16mm Spanners

Bearb. 10.05.1996 Krautnb.Sa. M 1:1
Gepr. Blatt 1

o	CAD-MTP	10.05.96	Kra.Sa.
Zust	Aenderung	Datum	Name